

Your Inspection Report



23 Teignmouth Ave
Toronto, ON M6E 1S6



PREPARED FOR:
GEORGINA BLANCHARD

INSPECTION DATE:
Wednesday, May 13, 2026

PREPARED BY:
Jonathan Dube, RHI



Carson, Dunlop & Associates Ltd.
1243 Islington Ave, Suite 900
Etobicoke, ON M8X 1Y9

416-964-9415
www.carsondunlop.com
inspection@carsondunlop.com

Excellence in home inspection



June 3, 2026

Dear Georgina Blanchard,

RE: Report No. 97455, v.3
23 Teignmouth Ave
Toronto, ON
M6E 1S6

Thank you for choosing us to perform your home inspection. We hope the experience met your expectations.

The enclosed report includes an Overview tab which summarizes key findings, and the report body. The Good Advice tab provides helpful tips for looking after your home; and the Appendix tab includes valuable added benefits. You can navigate by clicking the tabs at the top of each page.

TO THE PROSPECTIVE BUYER: Our obligation and liability are limited to the seller.

Thanks again for choosing Carson Dunlop

Sincerely,

Jonathan Dube, RHI
on behalf of
Carson, Dunlop & Associates Ltd.

Carson, Dunlop & Associates Ltd.
1243 Islington Ave, Suite 900
Etobicoke, ON M8X 1Y9
416-964-9415
www.carsondunlop.com
inspection@carsondunlop.com

OVERVIEW

23 Teignmouth Ave, Toronto, ON May 13, 2026

Report No. 97455, v.3

www.carsondunlop.com

OVERVIEW

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

RECALCHEK

OUR ADVICE

APPENDIX

REFERENCE

This Overview lists some of the significant report items if any were identified. Please read the entire report before making any decisions about the home; do not rely solely on the Overview.

FOR THE BUYER

There are two elements to a home inspection - the inspection itself and the report. This report is helpful, but the inspection is equally important. You need both elements to make an informed decision.

When you move into the home you may find some issues not identified in the report. That is to be expected for a few reasons, such as furniture and storage that has been removed, changes to the property conditions, etc. Therefore, we suggest you allow roughly 1% of the value of the home annually for maintenance and repair.

Our obligation and liability are limited to the seller.

Heating

FURNACE \ Life expectancy

Condition: • Near end of life expectancy

Although the furnace is close to the end of its life, continue to use and maintain the unit until it fails. Be prepared to replace the furnace at any time.

Location: Furnace room

Task: Replace

Time: When necessary

Cost: \$3,500-\$7,000

Cooling & Heat Pump

AIR CONDITIONING \ Life expectancy

Condition: • Air conditioner past typical life expectancy

Be prepared to replace at any time.

Task: Replace

Time: Soon

Cost: \$3,000 - \$6,000

Interior

BASEMENT \ Wet basement - evidence

Condition: • Evidence of moisture noted

During the pre-listing inspection, localized moisture was observed along the left side of the basement (near furnace). This was suspected to be related to the neighbour's downspout discharging below grade, which may have been clogged or improperly draining. The downspout has since been extended above grade to improve drainage away from the foundation. This corrective action should help reduce the potential for moisture intrusion. Recommend monitoring the area for any signs of recurrence

OVERVIEW

23 Teignmouth Ave, Toronto, ON May 13, 2026

Report No. 97455, v.3

www.carsondunlop.com

OVERVIEW

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

RECALCHEK

OUR ADVICE

APPENDIX

REFERENCE

Location: Left side of basement (near furnace)

Task: Monitor

Cost: Minor

Here are a few thoughts to help you stay warm, safe and dry in your home.

All homes require regular maintenance and periodic updates. Maintenance programs help keep homes safe, comfortable and efficient. Roofs, furnaces and air conditioners for example, wear out and have to be replaced. Good maintenance extends the life of these house systems. Refer to Our Advice tab for more details regarding maintenance of your home.

Water is the biggest enemy of homes, whether from leaks through the roof, walls or foundation, or from plumbing inside the home. Preventative maintenance and quick response to water problems are important to minimize damage, costs and help prevent mould.

Environmental consultants can help with issues like mould, indoor air quality and asbestos. If you need help in these areas, we can connect you with professionals.

All recommendations in the report should be addressed by qualified specialists. Our ballpark costs and time frames are provided as a courtesy and should be confirmed with quotes from specialists. Minor costs in the report are typically under \$1,000.

END OF OVERVIEW

ROOFING

23 Teignmouth Ave, Toronto, ON May 13, 2026

Report No. 97455, v.3

www.carsondunlop.com

OVERVIEW

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

RECALCHEK

OUR ADVICE

APPENDIX

REFERENCE

Description

Sloped roofing material:

- Asphalt shingles



Asphalt shingles



Asphalt shingles

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • The roof shingles are in good overall condition.

Annual inspections are recommended (on any roof) to take care of any roof damage and/or regular maintenance items (flashings/caulking).

Inspection Methods and Limitations

Inspection limited/prevented by: • Pitch angle of roof is greater than 6/12

Inspection performed: • With a drone

Age determined by: • Visual inspection

EXTERIOR

23 Teignmouth Ave, Toronto, ON May 13, 2026

Report No. 97455, v.3

www.carsondunlop.com

OVERVIEW

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

RECALCHEK

OUR ADVICE

APPENDIX

REFERENCE

Description

Wall surfaces and trim: • [Brick](#) • [Vinyl siding](#) • Wood siding

Observations and Recommendations

EXTERIOR \ Window wells

Condition: • Missing

It may be impractical to put a window well in this location, consider replacing the window with a smaller one to increase the sill height, or removing the window and filling with glass block or masonry.

Location: Right side

Task: Improve/Monitor/Keep area clear of accumulated snow

Cost: Depends on approach



Missing

Inspection Methods and Limitations

Inspection limited/prevented by: • Poor access under steps, deck, porch • Inaccessible wall

Exterior inspected from: • Ground level

Description

General: • The structure has performed well, with no evidence of significant movement.

Configuration: • [Basement](#)

Foundation material: • [Masonry block](#) • Not visible in areas

Floor construction: • [Joists](#) • Subfloor - plank • Not visible in some areas

Exterior wall construction: • [Wood frame](#) • [Masonry](#)

Roof and ceiling framing:

- Rafters/ceiling joists
- [Plywood sheathing](#)



Rafters / Joists / Plywood sheathing

- Not visible in some areas



Plywood sheathing

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • Most foundation walls and masonry walls have small cracks due to minor shrinkage, settlement or shifting. These will not be individually noted, unless leakage or building movement is noted.

FLOORS \ Concrete slabs

Condition: • Concrete basement, crawlspace and garage floors are not typically part of the structure. Almost all basement, crawlspace and garage concrete floors have minor shrinkage and settlement cracks.

OVERVIEW

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

RECALCHEK

OUR ADVICE

APPENDIX

REFERENCE

Inspection Methods and Limitations

Attic/roof space: • Inspected from access hatch

- OVERVIEW
 - ROOFING
 - EXTERIOR
 - STRUCTURE
 - ELECTRICAL**
 - HEATING
 - COOLING
 - INSULATION
 - PLUMBING
 - INTERIOR
- RECALCHEK
 - OUR ADVICE
 - APPENDIX
 - REFERENCE

Description


Service size: • [100 Amps \(240 Volts\)](#)

Main disconnect/service box type and location:

- [Breakers - basement](#)



Breakers - basement

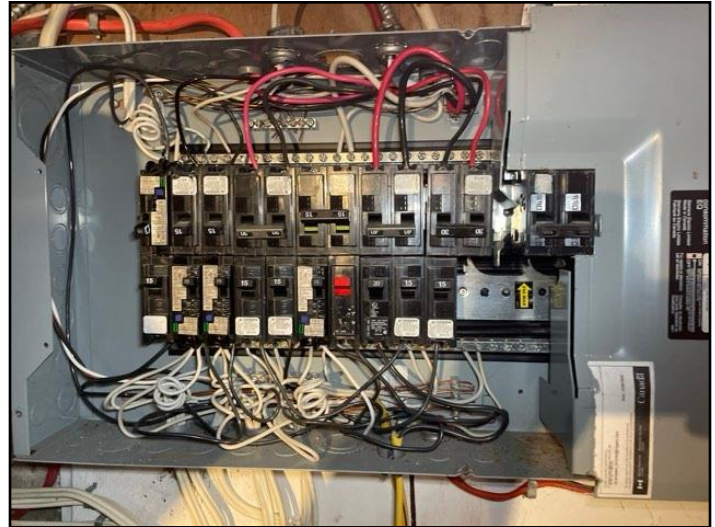

Breakers - basement

Distribution wire (conductor) material and type: • [Copper - non-metallic sheathed](#) • [Copper - metallic sheathed](#)

Circuit interrupters: Ground Fault (GFCI) & Arc Fault (AFCI): • [GFCIs present](#) • [AFCIs present](#)

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • No electrical recommendations are offered as a result of this inspection.

Inspection Methods and Limitations

Inspection limited/prevented by: • AFCIs (Arc Fault Circuit Interrupters) are not tested in a home that is occupied or where testing may cause damage. These should be tested monthly by the homeowner.

Inspection limited/prevented by: • Main disconnect cover not removed - unsafe to do so.

Description

Heating system type:

- [Furnace](#)



Furnace



Furnace

Fuel/energy source: • [Gas](#)

Approximate capacity: • [70,000 BTU/hr](#)

Efficiency: • [High-efficiency](#)

Approximate age: • [19 years](#)

Typical life expectancy: • Furnace (high efficiency) 15 to 20 years

Fireplace/stove: • [Gas fireplace](#)

Exhaust/Chimney/vent: • Sidewall venting

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • It is common to feel the airflow stronger at some registers, depending on the length of the ductwork and the number of turns required to get there. Different preferences and seasons often necessitate different setups (balancing). A service agreement that covers parts and labour (for heating and cooling equipment) is typically advised.

Location: Throughout

Task: Monitor / improve

FURNACE \ Life expectancy

Condition: • Near end of life expectancy

Although the furnace is close to the end of its life, continue to use and maintain the unit until it fails. Be prepared to replace the furnace at any time.

Location: Furnace room

Task: Replace

HEATING

23 Teignmouth Ave, Toronto, ON May 13, 2026

Report No. 97455, v.3

www.carsondunlop.com

OVERVIEW

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

RECALCHEK

OUR ADVICE

APPENDIX

REFERENCE

Time: When necessary

Cost: \$3,500-\$7,000

FIREPLACE \ Gas fireplace or gas logs

Condition: • A specialist should be engaged to inspect the gas fireplace prior to using the appliance. There are many manufacturers and many models of these units, with many different installation rules. We also recommend the gas fireplace be covered under a maintenance contract that includes regular service.

Task: Provide

Time: Before using

Inspection Methods and Limitations

General: • The inspection does not include gas leak detection, carbon monoxide testing, combustion analysis, or evaluation of internal furnace components.

Description

Air conditioning type:

- [Air cooled](#)



Air cooled

Cooling capacity: • [24,000 BTU/hr](#)

Compressor approximate age: • 19 years

Typical life expectancy: • 10 to 15 years

Observations and Recommendations

AIR CONDITIONING \ Life expectancy

Condition: • Air conditioner past typical life expectancy

Be prepared to replace at any time.

Task: Replace

Time: Soon

Cost: \$3,000 - \$6,000

Inspection Methods and Limitations

Inspection limited by: • Cooling systems are not operated when the outdoor temperature is below 60°F

Description

General: • The attic insulation level is consistent with modern standards.

Attic/roof insulation material:

- [Cellulose](#)



Cellulose

Attic/roof insulation amount/value:

- [R-40](#)

Second floor attic

- R-50

Rear attic(accessed through main floor bathroom)

Attic/roof air/vapor barrier: • [Plastic](#)

Observations and Recommendations

ATTIC/ROOF \ Hatch/Door

Condition: • [Not insulated and not weatherstripped](#)


Neither access door is insulated or weatherstripped, Improvements will help reduce heating and cooling loss through the hatch

Location: Various

Task: Improve

Time: As soon as practical

Cost: Minor

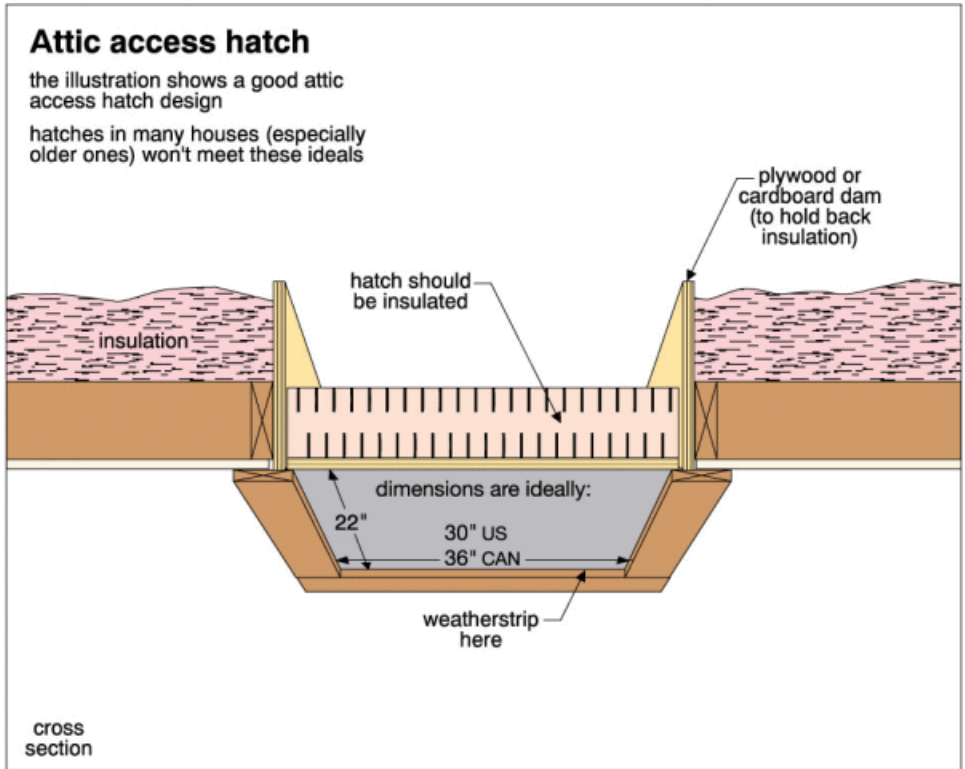

Not insulated and not weatherstripped

OVERVIEW

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

RECALCHEK

OUR ADVICE

APPENDIX

REFERENCE

Inspection Methods and Limitations

Inspection limited/prevented by lack of access to: • Crawlspace

Inspection limited/prevented by lack of access to: • Wall space - access not gained

Attic inspection performed: • From access hatch

Roof ventilation system performance: • Not evaluated

Description

Service piping into building: • [Copper](#)

Supply piping in building: • [Copper](#) • PEX (cross-linked Polyethylene)

Main water shut off valve at the: • Front of the basement

Water heater type: • Tankless/On demand

Water heater fuel/energy source: • [Gas](#)

Water heater approximate age: • 12 years


Water heater typical life expectancy: • 10 to 20 years

Waste and vent piping in building: • [ABS plastic](#) • [Cast iron](#)

Floor drain location: • Near laundry area

Backwater valve:

• Present. This valve helps prevent municipal sewers from backing up into the home. A backwater valve may help with your home owner's insurance.

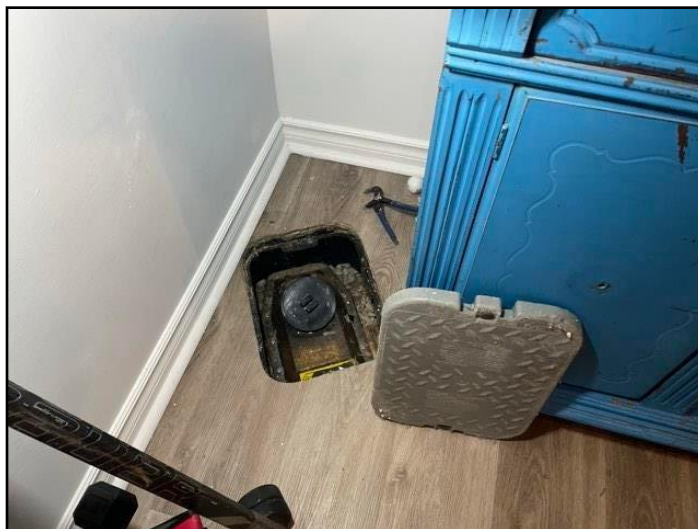

Backwater valve

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • Many plumbing fixtures may be expected to last 15 years or more, although faucets are often replaced every 10 years.

WASTE PLUMBING \ Drain piping - performance

Condition: • The main sewer line to the street cannot be inspected during a home inspection. A video scan dramatically reduces the risk of expensive and unhealthy sewer back-ups.

Task: Provide after possession of the home.

Cost: \$300 and up

- OVERVIEW
 - ROOFING
 - EXTERIOR
 - STRUCTURE
 - ELECTRICAL
 - HEATING
 - COOLING
 - INSULATION
 - PLUMBING**
 - INTERIOR
- RECALCHEK
 - OUR ADVICE
 - APPENDIX
 - REFERENCE

Inspection Methods and Limitations

Items excluded from a building inspection: • Tub/sink overflows

- OVERVIEW
- ROOFING
- EXTERIOR
- STRUCTURE
- ELECTRICAL
- HEATING
- COOLING
- INSULATION
- PLUMBING
- INTERIOR
- RECALCHEK
- OUR ADVICE
- APPENDIX
- REFERENCE

Description

General: • Interior finishes are in good repair overall. • The newer windows help improve comfort and energy efficiency.

Observations and Recommendations

CEILINGS AND WALLS \ General notes

Condition: • Typical minor flaws

FLOORS \ General notes

Condition: • Typical flaws

These cosmetic issues reflect normal wear and tear.

Location: Throughout

Condition: • Damage

The flooring appears to have been installed over a somewhat uneven substrate. As a result, some stress at the interlocking joints was noted, with loose boards, minor gaps, and localized damage observed at time of inspection. These conditions may progress with normal use and could result in further wear or minor tripping concerns over time.

Location: Basement

Task: Repair/Replace

Time: As needed/desired

Cost: \$2,500-\$5,000 (if replacing)



Crack



Broken tabs

| | | | | | | | | | |
|-----------|------------|----------|-----------|------------|---------|---------|------------|----------|----------|
| OVERVIEW | ROOFING | EXTERIOR | STRUCTURE | ELECTRICAL | HEATING | COOLING | INSULATION | PLUMBING | INTERIOR |
| RECALCHEK | OUR ADVICE | APPENDIX | REFERENCE | | | | | | |



Gaps

STAIRS \ Handrails and guards

Condition: • [Missing](#)

Location: Basement

Task: Provide

Time: As needed/desired

Cost: Minor

BASEMENT \ Leakage

Condition: • Typical reading noted with meter during inspection.

Location: Basement



Front - Typical reading noted - Dry



Right side Typical reading noted - Dry

| | | | | | | | | | |
|-----------|------------|----------|-----------|------------|---------|---------|------------|----------|----------|
| OVERVIEW | ROOFING | EXTERIOR | STRUCTURE | ELECTRICAL | HEATING | COOLING | INSULATION | PLUMBING | INTERIOR |
| RECALCHEK | OUR ADVICE | APPENDIX | REFERENCE | | | | | | |



Rear - Typical reading noted - Dry

Condition: • Almost every basement (and crawlspace) leaks under the right conditions. Based on a one-time visit, it's impossible to know how often or severe leaks may be. While we look for evidence of past leakage during our consultation, this is often not a good indicator of current conditions. Exterior conditions such as poorly performing gutters and downspouts, and ground sloping down toward the house often cause basement leakage problems. Please read Section 10.0 in the Interior section of the Home Reference Book before taking any action. You can find this in the Reference tab at the end of the report.

To summarize, wet basement issues can be addressed in 4 steps:

1. First, ensure gutters and downspouts carry roof run-off away from the home. (relatively low cost)
2. If problems persist, slope the ground (including walks, patios and driveways) to direct water away from the home. (Low cost if done by homeowner. Higher cost if done by contractor or if driveways, patios and expensive landscaping are disturbed.)
3. If the problem is not resolved and the foundation is poured concrete, seal any leaking cracks and form-tie holes from the inside. (A typical cost is \$300 to \$600 per crack or hole.)
4. As a last resort, dampproof the exterior of the foundation, provide a drainage membrane and add/repair perimeter drainage tile. (High cost)

BASEMENT \ Cold room/Root cellar

Condition: • Finished: risk of condensation problems
Ceiling is insulated and partially finished. No signs of moisture noted.

Location: Cold room

Task: Improve

Time: As needed/desired

| | | | | | | | | | |
|-----------|------------|----------|-----------|------------|---------|---------|------------|----------|----------|
| OVERVIEW | ROOFING | EXTERIOR | STRUCTURE | ELECTRICAL | HEATING | COOLING | INSULATION | PLUMBING | INTERIOR |
| RECALCHEK | OUR ADVICE | APPENDIX | REFERENCE | | | | | | |

BASEMENT \ Wet basement - evidence


Condition: • Evidence of moisture noted

During the pre-listing inspection, localized moisture was observed along the left side of the basement (near furnace). This was suspected to be related to the neighbour's downspout discharging below grade, which may have been clogged or improperly draining. The downspout has since been extended above grade to improve drainage away from the foundation. This corrective action should help reduce the potential for moisture intrusion. Recommend monitoring the area for any signs of recurrence


Location: Left side of basement (near furnace)

Task: Monitor

Cost: Minor

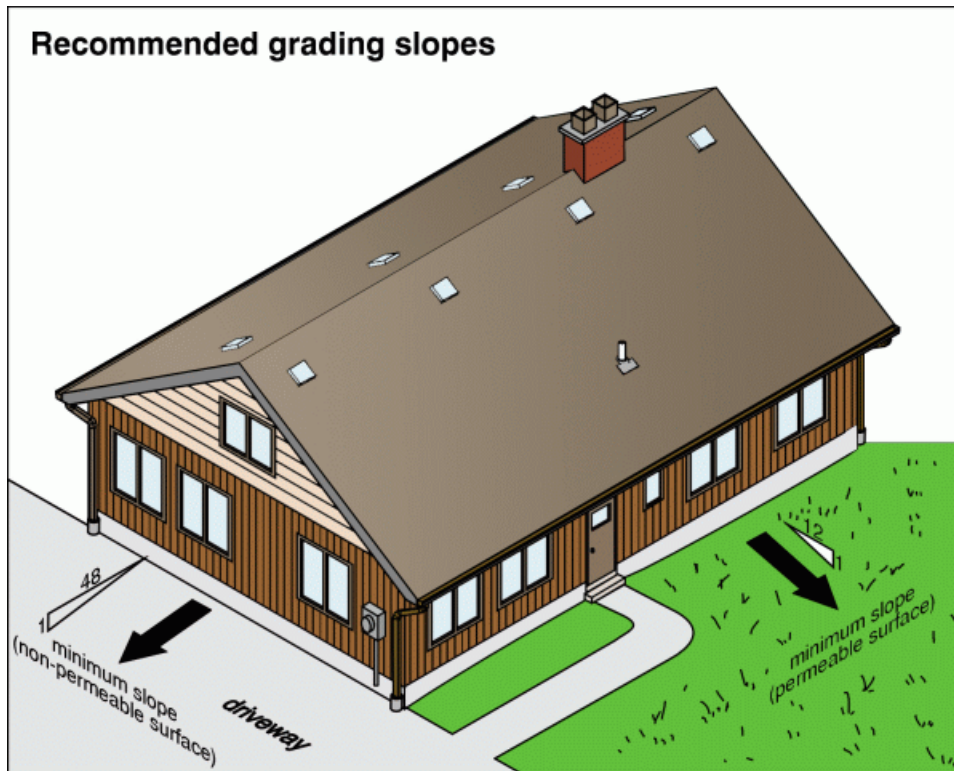

| | | | | | | | | | |
|-----------|------------|----------|-----------|------------|---------|---------|------------|----------|----------|
| OVERVIEW | ROOFING | EXTERIOR | STRUCTURE | ELECTRICAL | HEATING | COOLING | INSULATION | PLUMBING | INTERIOR |
| RECALCHEK | OUR ADVICE | APPENDIX | REFERENCE | | | | | | |

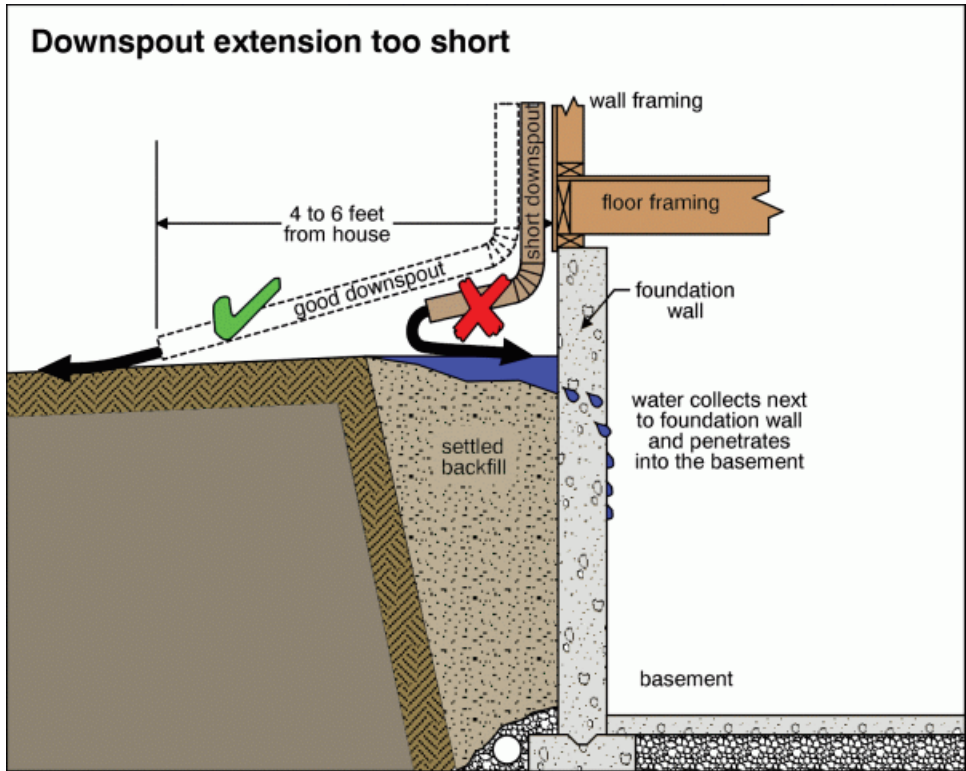

Elevated readings



Near furnace

Inspection Methods and Limitations

Inspection limited/prevented by: • Storage/furnishings • Storage in closets and cabinets / cupboards • Appliances inspections are limited scope, and some issues may not be identified.

Not included as part of a building inspection: • Carbon monoxide alarms (detectors), smoke detectors, security systems, central vacuum, window coatings and seals between panes of glass.

Percent of interior foundation not visible: • 95 %

- OVERVIEW
- ROOFING
- EXTERIOR
- STRUCTURE
- ELECTRICAL
- HEATING
- COOLING
- INSULATION
- PLUMBING
- INTERIOR
- RECALCHEK
- OUR ADVICE
- APPENDIX
- REFERENCE

Description

General: • We include a check for product recalls on major appliances at no extra cost. You will receive a separate report from RecallChek with any notices of product recalls and who to contact to get parts replaced, often free of charge. If there are recalls down the road, you will be notified. If you replace the equipment, just let RecallChek know and you will receive recall notices on these too.

Air Conditioner / Heat Pump:

- Lennox




Lennox

Furnace:

- Goodman

- OVERVIEW
- ROOFING
- EXTERIOR
- STRUCTURE
- ELECTRICAL
- HEATING
- COOLING
- INSULATION
- PLUMBING
- INTERIOR
- RECALCHEK
- OUR ADVICE
- APPENDIX
- REFERENCE

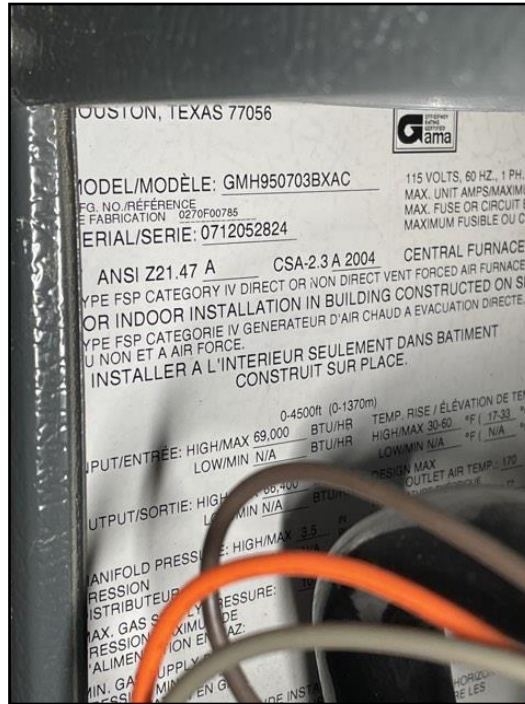

Goodman

Range:

- Samsung



Samsung

| | | | | | | | | | |
|-----------|------------|----------|-----------|------------|---------|---------|------------|----------|----------|
| OVERVIEW | ROOFING | EXTERIOR | STRUCTURE | ELECTRICAL | HEATING | COOLING | INSULATION | PLUMBING | INTERIOR |
| RECALCHEK | OUR ADVICE | APPENDIX | REFERENCE | | | | | | |

Dishwasher:


- Frigidaire



Frigidaire

Washer:

- Amana

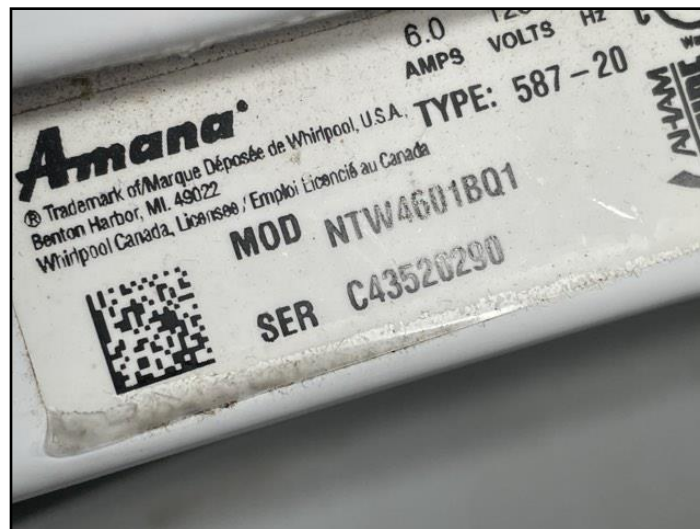

Amana

Dryer:

- GE

| | | | | | | | | | |
|-----------|------------|----------|-----------|------------|---------|---------|------------|----------|----------|
| OVERVIEW | ROOFING | EXTERIOR | STRUCTURE | ELECTRICAL | HEATING | COOLING | INSULATION | PLUMBING | INTERIOR |
| RECALCHEK | OUR ADVICE | APPENDIX | REFERENCE | | | | | | |



GE

| | | | | | | | | | |
|-----------|------------|----------|-----------|------------|---------|---------|------------|----------|----------|
| OVERVIEW | ROOFING | EXTERIOR | STRUCTURE | ELECTRICAL | HEATING | COOLING | INSULATION | PLUMBING | INTERIOR |
| RECALCHEK | OUR ADVICE | APPENDIX | REFERENCE | | | | | | |

Description

OUR ADVICE FOR LOOKING AFTER YOUR HOME: • Home maintenance is an important responsibility. It protects your investment, extends life expectancy and helps avoid significant expenses. This document is an integral part of the report, and will help you avoid many common problems and reduce costs.

Priority Maintenance and Home Set-Up: • The Home Set-Up and Maintenance chapter in the Home Reference Book provides important information regarding things that are done once when moving in, as well as regular maintenance activities.

Please be sure to follow these maintenance guidelines. The Home Reference Book is included under the REFERENCE tab in this report.

Basement/Crawlspace Leakage: • Basement water leakage is the most common problem with homes. Almost every basement and crawlspace leaks under the right conditions. Good maintenance of exterior grading, gutters and downspouts is critically important.

For more details, please refer to Section 10 of the Interior chapter of the Home Reference Book, which is in the REFERENCE tab in this report.

Roof - Annual Maintenance: • It is important to set up an annual inspection and tune-up program to minimize the risk of leakage and maximize the life of the roof. Roof leaks may occur at any time and are most often at penetrations or changes in material. A leak does not necessarily mean the roof needs to be replaced.

Roof coverings are disposable and have to be replaced from time to time. Asphalt shingles, for example, last roughly 15 years.

Also, in a mature neighborhood with mature trees, gutters and downspouts can readily become clogged with leaves and debris. Seasonal maintenance and cleaning can help promote adequate drainage from the roof structure and help keep water away from the home and foundation.

Exterior - Annual Maintenance: • Annual inspection of the exterior is important to ensure weather-tightness and durability of exterior components. Grading around the home should slope to drain water away from the foundation to help keep the basement dry.

Painting and caulking should be well maintained. Particular attention should be paid to horizontal surfaces where water may collect.

Joints, intersections, penetrations and other places where water may enter the building assembly should be checked and maintained regularly.

The water supply for all hose bibbs should be shut off from the interior shut-off valve(s) provided and the line(s) drained each season before winter; to help prevent potential freezing of the water supply pipe(s) and subsequent possible flooding issues.

Garage Door Operators: • The auto reverse mechanism on your garage door opener should be tested monthly. The door should also reverse when it meets reasonable resistance, or if the 'photo eye' beam is broken.

| | | | | | | | | | |
|-----------|------------|----------|-----------|------------|---------|---------|------------|----------|----------|
| OVERVIEW | ROOFING | EXTERIOR | STRUCTURE | ELECTRICAL | HEATING | COOLING | INSULATION | PLUMBING | INTERIOR |
| RECALCHEK | OUR ADVICE | APPENDIX | REFERENCE | | | | | | |

Electrical System - Label the Panel: • Each circuit in the electrical panel should be labelled to indicate what it controls. This improves both safety and convenience. Where the panel is already labelled, the labelling should be verified as correct. Do not rely on existing labeling.

Ground Fault Circuit Interrupters and Arc Fault Circuit Interrupters: • These should be tested monthly using the test buttons on the receptacles or on the breakers in the electrical panel.

Heating and Cooling System - Annual Maintenance: • Set up an annual maintenance agreement that covers parts and labour for all heating and cooling equipment. This includes gas fireplaces and heaters, as well as furnaces, boilers and air conditioners. Include humidifiers and electronic air cleaners in the service agreement. Arrange the first visit as soon as possible after taking possession.

Check filters for furnaces and air conditioners monthly and change or clean as needed. Duct systems have to be balanced to maximize comfort and efficiency, and to minimize operating costs. Adjust the balancing for heating and cooling seasons, respectively.

For hot water systems, balancing should be done by a specialist due to the risk of leakage at radiator valves. These valves are not operated during a home inspection.

Bathtub and Shower Maintenance: • Caulking and grout in bathtubs and showers should be checked every 6 months, and improved as necessary to prevent leakage and water damage behind walls and below floors.

Water Heaters: • All water heaters should be flushed by a specialist every year to maximize performance and life expectancy. This is even more critical on tankless water heaters.

Washing Machine Hoses: • We suggest braided steel hoses rather than rubber hoses for connecting washing machines to supply piping in the home. A ruptured hose can result in serious water damage in a short time, especially if the laundry area is in or above a finished part of the home.

Clothes Dryer Vents: • We recommend that vents for clothes dryers discharge outside the home. The vent material should be smooth walled (not corrugated) metal, and the run should be as short and straight as practical. This reduces energy consumption and cost, as well as drying time for clothes. It also minimizes the risk of a lint fire inside the vent.

Lint filters in the dryer should be cleaned every time the dryer is used. There is a secondary lint trap in many condominiums. These should be cleaned regularly. There may also be a duct fan controlled by a wall switch. The fan should be ON whenever the dryer is used.

Dryer ducts should be inspected annually and cleaned as necessary to help reduce the risk of a fire, improve energy efficiency and reduce drying times.

Fireplace and Wood Stove Maintenance: • Wood burning appliances and chimneys should be inspected and cleaned before you use them, and annually thereafter. We recommend that specialists with a WETT (Wood Energy Technology Transfer, Inc.) designation perform this work. Many insurance companies require a WETT inspection for a property with a wood burning device.

Smoke and Carbon Monoxide (CO) Detectors/Alarms: • Smoke detectors are required at every floor level of every home, including basements and crawlspaces. Even if these are present when you move into the home, we recommend replacing the detectors. We strongly recommend photoelectric smoke detectors rather than ionization type detectors. Carbon monoxide detectors should be provided adjacent to all sleeping areas.

These devices are not tested during a home inspection. Detectors should be tested every 6 months, and replaced every 10 years. Batteries for smoke and carbon monoxide detectors should be replaced annually. If unsure of the age of a smoke detector, it should be replaced.

Backwater Valve: • A backwater valve protects your home from a backup of the municipal sewer system. The valve may be equipped with an alarm to notify you of a backup. Please note: if the valve is closed due to a municipal sewer backup, you cannot use the plumbing fixtures in the home. The waste water is unable to leave the building and will back up through floor drains and the lowest plumbing fixtures. • The valve should be inspected and cleaned as necessary at least twice a year.

Sump Pump: • A sump pump collects storm water below the basement floor and discharges it safely to the exterior to prevent flooding. The discharge point should be at least 6 feet (2 m) away from the home. Best installations include backup power for the sump pump, so it will work in the event of a power outage. A high water alarm in the sump pump will notify you if the pump fails. Some installations include a backup pump.

The sump and pump should be inspected and tested four times a year.

For condominium owners: • Condominium owners - Maintenance and Repairs: There are two types of repairs that may be performed in a condo - repairs to an individual condo unit and repairs to common elements. Common elements are set out in the Condominium Declaration and will differ from one building to another. If repairs must be made inside your unit, you are responsible for making the repairs at your own expense. You are also responsible for the ongoing maintenance of your unit. The condominium corporation's board of directors is responsible for maintenance and repair of the common elements. Exclusive-use common elements, such as parking spaces or balconies are generally maintained by the condominium board.

Be Ready for Emergencies: Be sure you know where to shut off the water. Some condos have more than one shut off, and others need a special tool (key) to turn off water. Label each circuit on the electrical panel, and make sure you should know how to turn off the power. Keep a fire extinguisher suitable for grease fires near the kitchen.

Property Manager and Concierge/Security: Keep the contact information for these folks handy (perhaps on your phone) wherever you are. • Lint filters in the dryer should be cleaned every time the dryer is used. There is a secondary lint trap in many condominiums. These should be cleaned regularly. There may also a duct fan controlled by a wall switch. The fan should be ON whenever the dryer is used.

END OF REPORT

| | | | | | | | | | |
|-----------|------------|----------|-----------|------------|---------|---------|------------|----------|----------|
| OVERVIEW | ROOFING | EXTERIOR | STRUCTURE | ELECTRICAL | HEATING | COOLING | INSULATION | PLUMBING | INTERIOR |
| RECALCHEK | OUR ADVICE | APPENDIX | REFERENCE | | | | | | |

Investments. Insurance. Advice. All in one place.

For more than 75 years, we’ve been helping Canadians, like you, build financial security. Whether you’re looking for investments, insurance or both, count on us for the personalized advice and solutions you need to keep what matters safe and save for what matters. Let us help you with:



Investments

Choose from straightforward saving and investing options to help you achieve financial success, however you define it.



Business

Design a plan that protects what you’ve worked so hard to build. And access unique services that help your business grow.



Life

Protect your loved ones, your assets and your financial future, with the right type and amount of coverage.



Farm

Secure your property and your livelihood, with a plan that accounts for the specifics of your farming operation.



Home

Keep your living space and everything within it safe, with a customized policy for your home, condominium or cottage.



Travel*

Enjoy affordable coverage, whether you’re travelling for work or play, and whether it’s a short visit or an extended stay.



Auto

Get coverage that factors in what you drive, when you drive, and discounts for a clean driving record. Add a policy for greater savings!



Group Benefits

Up your competitive edge, with a plan that supports the health and well-being of your most important asset: your employees.

Ready to build your financial future?

Talk to us about creating a plan that meets your needs for today and your goals for tomorrow.

RJB Insurance Group Inc.

30-1029 King Street West, Toronto
416-264-2281
rjb_insurance@cooperators.ca

Vel Insurance Services Inc.

708-10 Milner Business Court, Toronto
416-396-0707
vel_insurance@cooperators.ca

Investments. Insurance. Advice.



Investing in your future. Together.

Co-operators Financial Investment Services Inc.

*Travel offered is both inbound and outbound travel and is administered by Allianz Global Assistance. Mutual funds are offered through Co-operators Financial Investment Services Inc. to Canadian residents except those in Québec and the territories. Life products and Group Benefits plans are underwritten by Co-operators Life Insurance Company. Home, Auto, Commercial and Farm insurance is underwritten by Co-operators General Insurance Company. Not all products are available in all provinces. Please refer to your policy for applicable coverage limitations and exclusions. Co-operators General Insurance Company, Co-operators Life Insurance Company, and Co-operators Financial Investment Services Inc. are committed to protecting the privacy, confidentiality, accuracy and security of the personal information that we collect, use, retain and disclose in the course of conducting our business. Please visit www.cooperators.ca/en/PublicPages/Privacy.aspx for more information.

OVERVIEW

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

RECALCHEK

OUR ADVICE

APPENDIX

REFERENCE

The links below connect you to a series of documents that will help you understand your home and how it works. These are in addition to links attached to specific items in the report.

Click on any link to read about that system.

» 01. ROOFING, FLASHINGS AND CHIMNEYS

» 02. EXTERIOR

» 03. STRUCTURE

» 04. ELECTRICAL

» 05. HEATING

» 06. COOLING/HEAT PUMPS

» 07. INSULATION

» 08. PLUMBING

» 09. INTERIOR

» 10. APPLIANCES

» 11. LIFE CYCLES AND COSTS

» 12. SUPPLEMENTARY

Asbestos

Radon

Urea Formaldehyde Foam Insulation (UFFI)

Lead

Carbon Monoxide

Mold

Household Pests

Termites and Carpenter Ants

» 13. HOME SET-UP AND MAINTENANCE

» 14. MORE ABOUT HOME INSPECTIONS

